

QUALITY ASSURANCE DEPARTMENT

### FAILURE MODE EFFECT ANALYSIS FOR RAW MATERIAL SAMPLING (DPI)

S. No.	Item / Function	Potential Failure Mode	Potential Effect of Failure	Potential Cause/ Mechanism	Current Control	Reference			Risk with Current control MeasureRecommend Actions		Recommended Actions	Ri contro	sk afte ol meas		RPN (S*O*D)
			(Effect)	of Failure			s	0	D	Risk Priority Number (S*O*D)	(if any)	S	0	D	
1.	Raw Material Sampling	Probability of use of Un- cleaned garments	Product Failure & mix-up chances	<ul> <li>Procedure is not available for Garments cleaning</li> <li>Garments cleaning are performed by untrained personnel.</li> <li>In-adequate cleaning</li> <li>Garments Storage Cabinets are not provided for Storage of Garments</li> </ul>	<ul> <li>Cleaning is performed by trained personnel.</li> <li>Cleaning Procedure is available.</li> <li>Storage Cabinets are provided for storage of garments.</li> </ul>	SOP	1	1	4	4	NA	NA	NA	NA	NA
1.		Probability of mix up of material after Sampling	Contamination and Product failure	<ul> <li>Proper Status of Labeling is not done in each container of material.</li> <li>Container of Raw material are not segregated.</li> <li>SOP is not available for Raw material sampling.</li> <li>Proper storage condition</li> </ul>	<ul> <li>All containers of materials properly identified by status label.</li> <li>Staging room is provided for storage of sampled material and kept in Container with proper status label.</li> <li>SOP is available for Raw material sampling.</li> </ul>	SOP	1	4	4	16	NA	NA	NA	NA	NA



	FAILURE MODE EFFECT ANALYSIS FOR RAW MATERIAL SAMPLING (DPI)														
S.	Item /	Potential	Potential Effect	Potential Cause/	Current	Reference					Recommended	d Risk after control measure			<b>RPN</b>
No.	Function	Failure Mode	of Failure (Effect)	Mechanism of Failure	Control		control Measure Risk		Actions (if any)	contro	ol meas	sure	(S*O*D)		
							S	0	D	Priority Number (S*O*D)		S	0	D	
	Raw Material Sampling	Personnel Safety during Sampling	Contamination of raw material and Effect on Human Health	<ul> <li>not followed.</li> <li>&gt; Unskilled/Untrained person performing Sampling.</li> <li>&gt; Unclean Tools used for Sampling.</li> <li>&gt; RLAF not clean properly and Pressure Differential not in Limit.</li> <li>&gt; Weighing Balances are not clean.</li> <li>&gt; Proper gowning procedure is not followed.</li> <li>&gt; Safety devices are not available.</li> <li>&gt; Unskilled/untrained person performing Sampling.</li> </ul>	<ul> <li>Provision for controlled storage condition is available.</li> <li>Only trained/Skilled person performing Sampling.</li> <li>SOP for sampling tools cleaning is available.</li> <li>Line clearance procedure followed before start the Sampling</li> <li>Provision of Secondary Change Room before entry in Sampling Area. Gowning procedure are provided and followed.</li> <li>Safety devices are available i.e. PPE (personnel protective equipments), Gloves, mask, goggles, etc required safety devices</li> </ul>	SOP Safety manual	4	1	4	16	NA	NA	NA	NA	NA



			FAILU	JRE MODE EFFECT	ANALYSIS FOR RAW	MATERIAL	L SA	MP	PLI	NG (DPI	[)					
S.	Item /	Potential	Potential Effect		Current	Reference					Recommended		sk afte		RPN	
No.	Function	Failure Mode	of Failure (Effect)	Mechanism of Failure	Control		C	Control Measure Risk		control Measure Risk		Actions (if any)	contro	oi mea	sure	(S*O*D)
							S	0	D	Priority Number (S*O*D)		S	0	D		
	Raw Material Sampling			Activity is performed by without supervision of senior person.	<ul> <li>are provided. First aid facility is provided in case of any miss happening.</li> <li>&gt; Untrained person is not allowed to work in sampling area.</li> <li>&gt; List of Authorized personnel is displayed in all area.</li> <li>&gt; All activity is performed in presence of senior/experienced</li> </ul>											
		Contamination & Cross Contamination	Product Failure	<ul> <li>In adequate cleaning</li> <li>Area not qualified.</li> </ul>	<ul> <li>chemist.</li> <li>Proper cleaning &amp; sanitization procedure are followed.</li> <li>UVAC &amp; area are</li> </ul>	SOP	4	1	2	8	NA	NA	NA	NA	NA	
				<ul> <li>HVAC is not qualified.</li> <li>Procedure for area cleaning is not available</li> </ul>	<ul> <li>&gt; HVAC &amp; area are previously qualified.</li> <li>&gt; Validation cleaning procedure is available,</li> </ul>											
				& followed.	followed & documented.											



			FAILU	JRE MODE EFFECT	ANALYSIS FOR RAW	MATERIAL	SA	MP	<b>II</b>	NG (DPI	()				
S. No.	Item / Function	Potential Failure Mode	Potential Effect of Failure	Potential Cause/ Mechanism	Current Control	Reference				Current Ieasure	Recommended Actions	Ri contro	sk afte		RPN (S*O*D)
110.	runction	Fanure Moue	(Effect)	of Failure	Control					Risk	(if any)	contro			
							S	0	D	Priority Number		S	0	D	
										(S*O*D)					
				Procedure is not	Procedure is available &										
				available for cleaning schedule of area.	followed for cleaning schedule of area										
				➢ Validated Cleaning	► Validated Cleaning										
				Procedure is not available.	Procedure is available.										
				avanable.	➢ Pressure differential of										
					the area is maintained,										
	Raw			➢ Pressure differential of	monitored at defined										
	Material Sampling			area is not maintained & monitored in regular	frequency.										
	Sampling			intervals.											
					➤ Untrained/Unqualified										
					personnel is not allowed										
				Untrained / Unqualified personnel are allowed in	in the area.										
				the area.											
					➤ All activity is performed										
					by trained personnel.										
				Cleaning is performed by untrained personnel.											
				by unualied personnel.	Dedicated area is										
					provided for Storage of										
				Dedicated area is not	Cleaned Sampling tools.										
				provided for Storage of Cleaned sampling tools.											
				creation sumpring tools.	Separate Washing Area is										
					provided.										
				Separate Washing Area											
				is not provided.											



			FAILU	JRE MODE EFFECT	ANALYSIS FOR RAW	MATERIAL	, SA	MF	PLI	NG (DPI	[)				
S. No.	Item / Function	Potential Failure Mode	Potential Effect of Failure	Potential Cause/ Mechanism	Current Control	Reference				Current Ieasure	Recommended Actions	Risk after control measure			RPN (S*O*D)
1.00			(Effect)	of Failure						Risk	(if any)				(8 8 2)
							S	0	D	Priority Number (S*O*D)		S	0	D	
				<ul> <li>Dedicated AHUs is not provided for all the area.</li> <li>Procedure is not</li> </ul>	Dedicated AHUs is provided for all the store area.										
				available for AHU cleaning & filter cleaning	<ul> <li>Procedure is available for AHU cleaning &amp; filter cleaning</li> </ul>										
				Gowning procedure is not available & not followed.	Gowning procedure is available & followed.										
				Unidirectional men material movement / Flow are not provided.	Unidirectional Men Material Movement / Flow are provided.										
				<ul> <li>Pictorial for gowning procedure are not</li> </ul>	Pictorial for gowning procedure are displayed in respective area.										
				displayed in respective area.	Procedure is available for Line clearance of sampling area.										
				Procedure is not available for Line clearance of sampling area.	<ul> <li>Procedure is available for cleaning of AHU &amp; equipment filter</li> </ul>										
					Only single product sampled at a time.										



QUALITY ASSURANCE DEPARTMENT

### FAILURE MODE EFFECT ANALYSIS FOR RAW MATERIAL SAMPLING (DPI)

S. No.	Item / Function	Potential Failure Mode	Potential Effect of Failure (Effect)	Potential Cause/ Mechanism of Failure	Current Control	Reference	c	ol M	Current leasure Risk Priority Number (S*O*D)	(if any)	Ris contro S	sk afte l meas O	RPN (S*O*D)
				<ul> <li>Procedure is not available for cleaning of AHU &amp; equipment filter</li> <li>Two different products sampled at a time.</li> </ul>									

**Note:** Action shall be taken if Risk Priority Number is more than 64. **Where:** S=Severity; O=Occurrence Probability; D=Detection

Remarks (if any):

Quality Risk Manag		1	Reviewed By	Approved By					
Name	Department	Sign & Date	Head Operations Sign & Date	Head QA Sign & Date					
			Sign & Date	Sigii & Date					



QUALITY ASSURANCE DEPARTMENT

### FAILURE MODE EFFECT ANALYSIS FOR RAW MATERIAL SAMPLING (DPI)

#### QUALITY RISK ASSESSEMENT AND MITIGATION SUMMARY REPORT

Name of Facility / Equipment / Utility / System / Activity / Procedure / Unit Operation:	Raw Material Sampling (DPI)

S.No.	Recommended Action	<b>Responsible Person</b>	Target Date of Completion

#### Verification of Action Plan:

All the above agreed actions completed, Not Completed. (\*incase any recommendations Not completed, to be tracked through CAPA System)

#### Remarks (if any):

Verified By QA Sign & Date Approved By Head QA Sign & Date